Instructions: Low Voltage Surface Mount Fixture

Model: ME-826

CAUTION:

Always turn off power at main switch prior to installation to prevent electrical shock.

Read all instructions before installing.

For installation by a qualified electrician.

System is intended for installation in accordance with National Electric Code, and local regulations.

Consult with local inspector to assure compliance.

Install over a standard 4-inch junction box.


All wires must be contained in the junction box.


Installing fixture:

- Loosen the three canopy screws twist and separate the canopy cover from the base plate.
- 2. Remove knock out from the base plate.
- 3. Guide the white and black wires from the transformer through the knock out in the base plate and into the Junction box.
- 4. Connect with like colored line volt wires from the junction box to transformer wires, with wire nuts (supplied).
- 5. Connect green grounding wire from junction box (may be bare copper wire) to green wire from fixture.
- 6. Attach the base plate to a junction box using slotted holes.
- 7. Mount the canopy to the base plate by twisting key holes over three screws in base plate.
- 8. Tighten screws to secure canopy.

Installing lamp & shade:

- 1. Use a 12 volt MR16 bi-pin lamp, 50Watt maximum.
- 2. Remove the lens ring by turning counter clockwise, and remove the lens.
- 3. Insert lamp pins with the holes in the socket and push fully in.
- 4. Place the lens into the lens ring and screw on to the fixture.

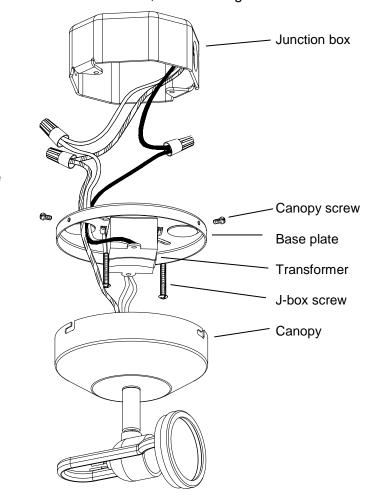

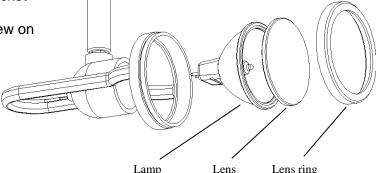



Retain these instructions for future service and adjustments 615 South Street, Garden City, NY 11530 Tel: (516) 515-5000 Fax (516) 515-5050 www.waclighting.com